



***For Your Convenience: This File Is
Shared By Diesel Parts Direct***



YOUR ONE STOP SUPERSTORE FOR DIESEL ENGINE PARTS

SHOP NOW


SERVICE PART NO.	COMPONENT PART NO'S	NO. REQ'D
11457	11455	1
BODY	413	2
10619	10611	1
COVER	6333-G	1
10927	10523	1
SEAL & SEAT	10926	1

MAJOR REPAIR KIT #12299
MINOR REPAIR KIT #10922


(E)

MODIFIED 11515 1 REQ'D
Nº9 WOODRUFF
KEY

THIS DIA. MUST BE CONCENTRIC WITH
6245/6250 DIA. WITHIN .002 FIR

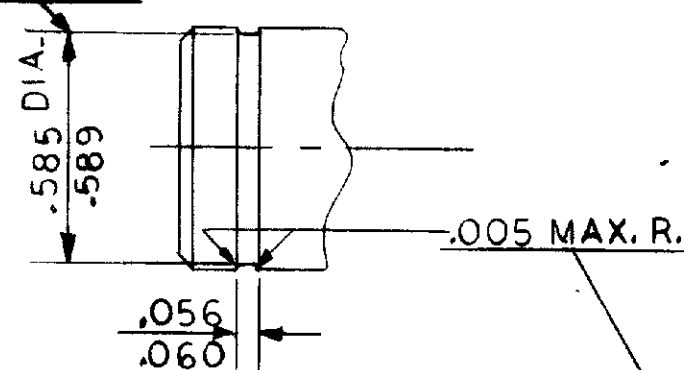

3/8-16 U.N.C.-2B TAP
2 HOLES

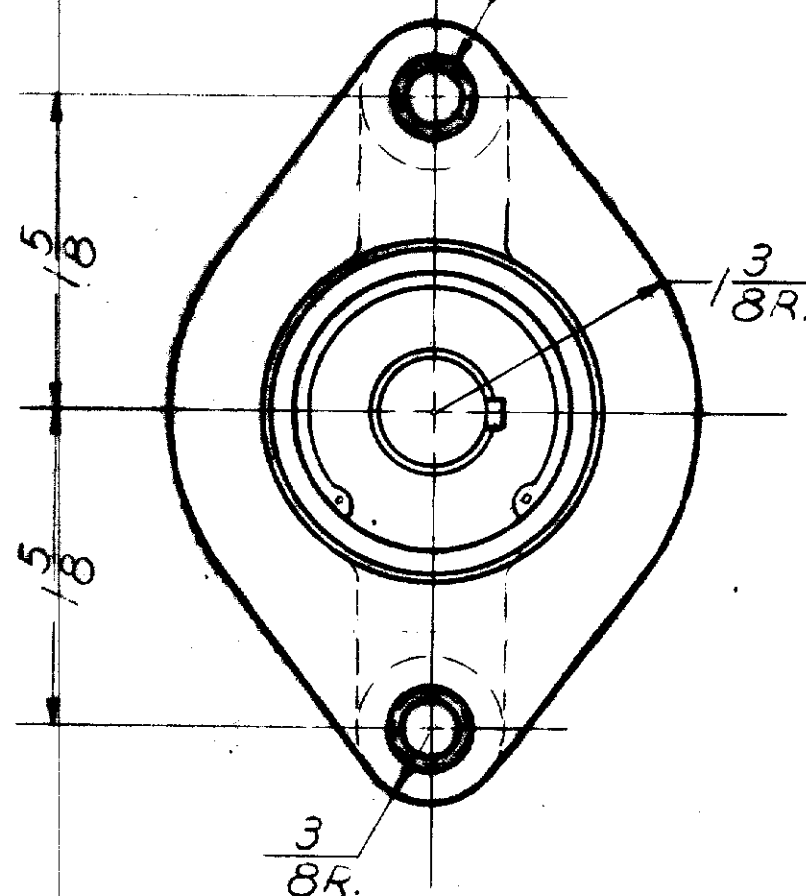

CAPACITY

20.0 G.P.M. @ 3600 R.P.M., OUTBOARD PORT
30.0 G.P.M. @ 3600 R.P.M., INBOARD PORT

(D) THIS PUMP ASSY IS TO BE SHIPPED
TO THE CUSTOMER IN A NO.10 CARTON
(WITH INSERTS) 10 PUMPS TO A CARTON

(F) FOR SERVICE:

PACKAGE THIS PUMP ASSEMBLY IN A
Y BOX 1 REQ'D

2 JIFFY BAG 1 REQ'D

12209 LABEL 1 REQ'D

(G) # 13472 SERVICE KIT ADDED 1 REQ'D

REDRAWN
WITHOUT CHANGE 6/8/87

SEALED, SELF-LUBRICATED BALL BEARING

CERAMIC SEAT

MECH.

SEAL

PERMATEX

GRAPHITAR BUSHING
3/16 STAINLESS STEEL SHAFT

STAMP PUMP ASSEMBLY
NO. AND DATE CODE ON TAG,
ATTACH WITH SCREW

CHRYSLER CORP
MARINE DIV.
Nº2847629

CURVE NO. 750078

H	ADDED TAG NO 13285	
G	NO 13472 SERVICE BULLETIN ADDED	RI 2-1-82
F	PACKAGING NOTE ADDED	RM 2-1-82
E	12299-10922 KIT REVISED	RM 6-20-68
D	NOTES ADDED	RM 7-2-67
C	MAJOR SERVICE KIT ADDED	RM 2-1-82
B	WAS 2 REQ'D	RM 2-1-82
A	WAS 2 REQ'D	RM 2-1-82

TITLE	DATE	MATERIAL
IMPELLER PUMP ASSY		SEE DETAILS
FULL		
B.R.	6-18-68	
A.V.B.	6-20-68	

D-55